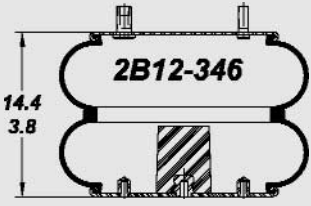
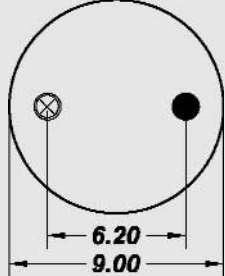
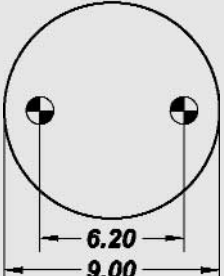
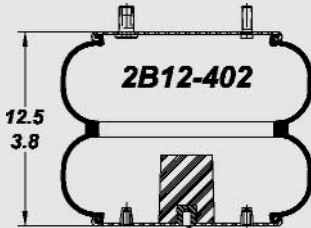
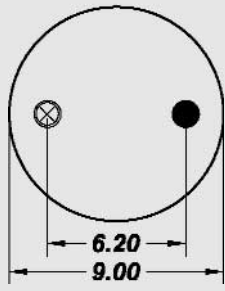
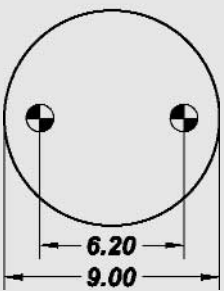
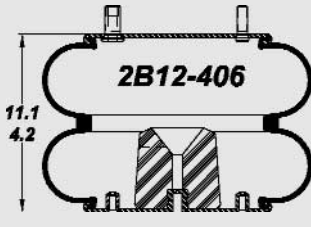
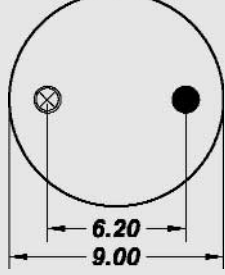
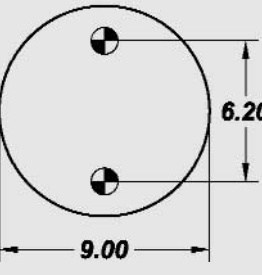
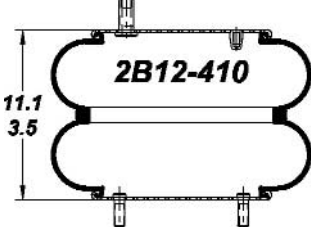
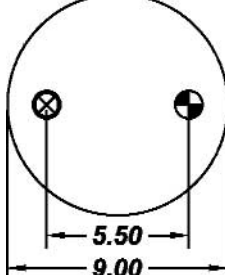
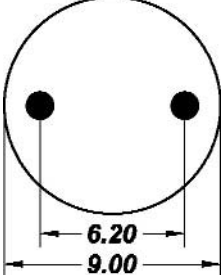
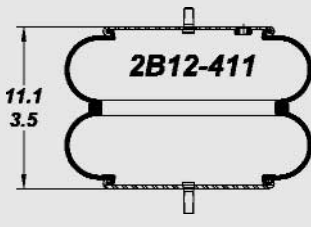
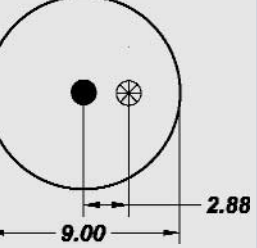
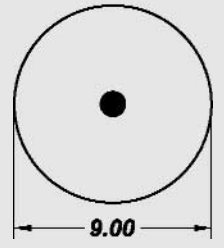


GOODYEAR PART NO.	Side View With Extended and Compressed Height	Upper Mounting View	Lower Mounting View	Replaces These Springs
<b>2B12-346</b>  Flexmember 578-92-3-315		<b>ASA-92-8-005</b> 	<b>ASA-92-6-002</b> 	<b>Firestone</b> 7550 <b>Triangle</b> 4541
<b>2B12-402</b>  Flexmember 578-92-3-310		<b>ASA-92-8-005</b> 	<b>ASA-92-6-002</b> 	<b>Dayton</b> 354-7446 <b>Firestone</b> 7446 <b>HDA</b> PMABG-7446B <b>Hendrickson</b> B-3798 <b>Load Guard</b> SC2027 <b>Navistar</b> 554791C1 <b>R&amp;S Truck</b> 1082914 <b>Triangle</b> 4370 <b>Watson &amp;Chalin</b> AS-0005
<b>2B12-406</b>  Flexmember 578-92-3-309		<b>ASA-92-8-005</b> 	<b>ASA-92-6-002</b> 	<b>Dayton</b> 354-7446 <b>Firestone</b> 7410 <b>Freightliner</b> 16-11378 <b>Load Guard</b> SC2023 <b>Navistar</b> 554792C1 <b>Taurus</b> AS214-7410 <b>Triangle</b> 4331
<b>2B12-410</b>  Flexmember 578-92-3-309		<b>ASA-92-8-017</b> 	<b>ASA-92-6-001</b> 	<b>Dayton</b> 354-7404 <b>Firestone</b> 7404 <b>Hendrickson</b> B-1345 B-5468 <b>Load Guard</b> SC2022 <b>Navistar</b> 554793C1 <b>Taurus</b> AS214-7404 <b>Triangle</b> 4346
<b>2B12-411</b>  Flexmember 578-92-3-309		<b>ASA-92-8-088</b> 	<b>ASA-92-6-006</b> 	<b>Dayton</b> 354-7181 <b>Firestone</b> 7181 <b>Fruehauf</b> UAB-5620 UCC-3054-1 <b>Load Guard</b> SC2018 <b>Navistar</b> 554794C1 <b>Taurus</b> AS214-7181 <b>Triangle</b> 4472

50

- - Bolt or Stud - 1/2-13 or 1/2-20
- ⊗ - Air Fitting - 1/4 NPTF
- - Stud - 3/4-10
- - Tapped Hole on Top Retainers
- ⊗ - Air Fitting - 1/2 NPTF
- ⊗ - Combination Stud Air Fitting
- - 3/8-16, on Pistons - 1/2-13
- 3/8 NPTF
- Stud - 3/4-16; Air Fitting - 1/4 NPTF