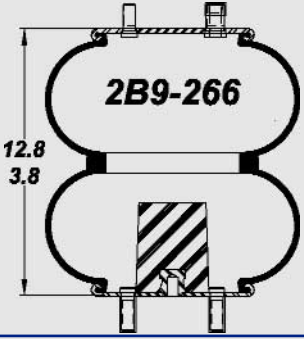
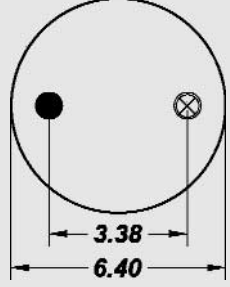
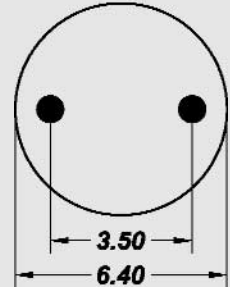
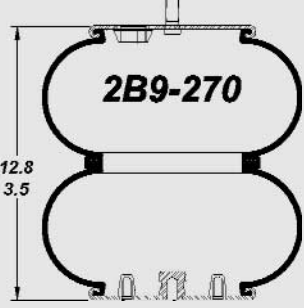

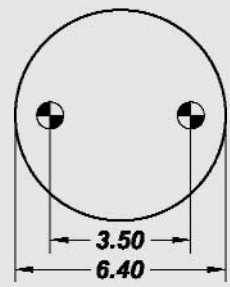
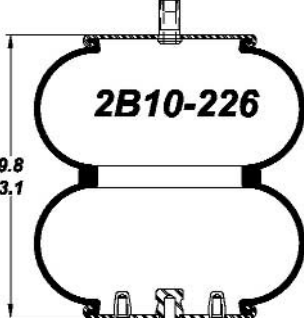
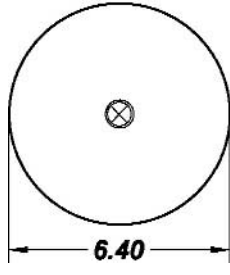
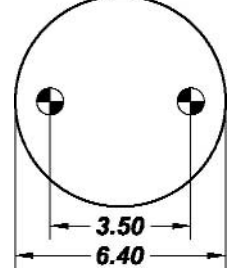
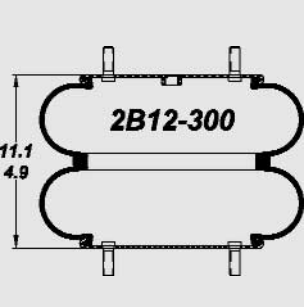
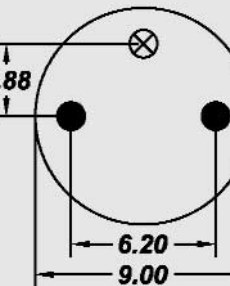
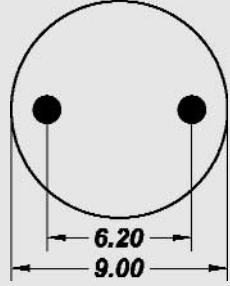
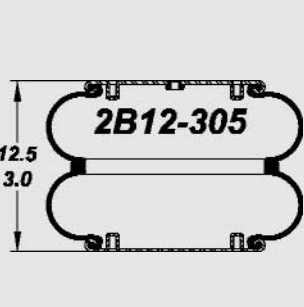
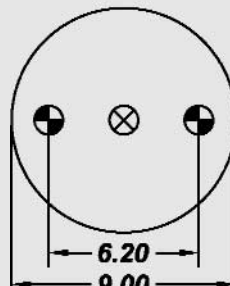
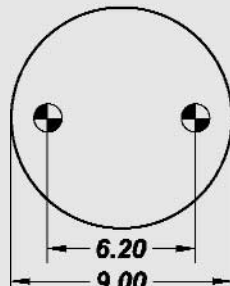


# BELLOWS STYLE

GOODYEAR PART NO.	Side View With Extended and Compressed Height	Upper Mounting View	Lower Mounting View	Replaces These Springs
<b>2B9-266</b>  Flexmember 578-92-3-208		<b>ASA-92-8-292</b> 	<b>ASA-92-6-044</b> 	<b>Firestone</b> 6944 <b>Triangle</b> 4454
<b>2B9-270</b>  Flexmember 578-92-3-206		<b>ASA-92-8-298</b> 	<b>ASA-92-6-010</b> 	<b>Ridewell</b> 1002B09270G
<b>2B10-226</b>  Flexmember 578-92-3-250		<b>AS1-92-8-113</b> 	<b>ASA-92-6-010</b> 	<b>Firestone</b> 7795 <b>Hendrickson</b> B14486 <b>Triangle</b> 4524
<b>2B12-300</b>  Flexmember 578-92-3-309		<b>ASA-92-8-003</b> 	<b>ASA-92-6-001</b> 	<b>Dayton</b> 354-7424 <b>Firestone</b> 7424 <b>HDA</b> PMABG-7424B <b>Load Guard</b> SC2024 <b>Navistar</b> 554785C1 <b>Neway</b> TC-144-2  90557014 <b>R&amp;S Truck</b> 1090215 <b>Porcupine</b> <b>Sauer Axles</b> P10-755 <b>Taurus</b> AS214-7424 <b>Triangle</b> 4327 <b>Watson&amp;Chal</b> n AS-0009
<b>2B12-305</b>  Flexmember 578-92-3-310		<b>AS1-92-8-026</b> 	<b>AS1-92-6-002</b> 	<b>Dayton</b> 354-7443 <b>Firestone</b> 7443 <b>Granning</b> 1218 1589 <b>Load Guard</b> SC2026 <b>Navistar</b> 554786C1 <b>Ridewell</b> S-2683C  <b>Triangle</b> 4323 <b>Watson&amp;Chal</b> n AS-0027

- - Bolt or Stud - 1/2-13 or 1/2-20
- ⊗ - Air Fitting - 1/4 NPTF
- ⊙ - Stud - 3/4-10
- ⊕ - Tapped Hole on Top Retainers
- ⊗ - Air Fitting - 1/2 NPTF
- ⊗ - Combination Stud Air Fitting
- 3/8-16, on Pistons - 1/2-13
- 3/8 NPTF
- Stud - 3/4-16; Air Fitting - 1/4 NPTF